

HTECHNICAL BULLETIN

PRIMAAX® / FIREMAAX® Support Beam Assembly

SUBJECT: Discontinued Support Beam

Assemblies


LIT NO: SEU-0229

DATE: April 2010 REVISION: A

IMPORTANT NOTICE

Effective May 1, 2010, support beam assembly part numbers 66435-00X or 60831-00X (Forging Part Nos. 59363-001, 65082-000, and 65284-000) for PRIMAAX® • FIREMAAX® suspension systems are discontinued for field service purposes for North and Central America, see Figure 1.

FIGURE 1

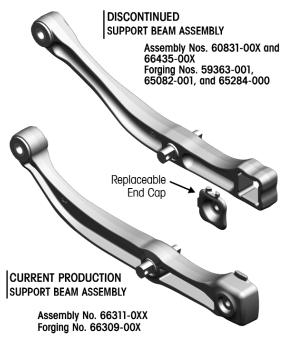


U-beam assembly service kits (part number 60961-XXX, see Figure 2) **must be** used for any necessary replacement of PRIMAAX • FIREMAAX support beam assemblies (part numbers 66435-00X or 60831-00X) in the field. Refer to Table 1 on page 3 to determine the U-beam assembly service kit for each respective vehicle manufacturer.

Follow the PRIMAAX EX • FIREMAAX EX • PRIMAAX • FIREMAAX component replacement procedures and safety instructions in Hendrickson Technical Publication number 17730-238 to install the U-beam assembly service kits. Visit Hendrickson's website for the latest version of 17730-238.

FIGURE 2

U-beam Assembly Service Kit equipped with current production support beams

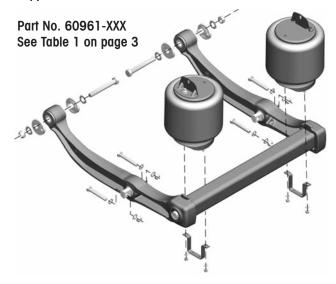



U-BEAM ASSEMBLY SERVICE KIT INSTALLATION

The U-beam assembly service kits (part number 60961-XXX, see Figure 2) are designed for the discontinued support beam assemblies and their related components on one axle and do not require additional drilling or modifications.



DO NOT USE A COMBINATION OF A DISCONTINUED (PART NOS. 60831-00X OR 66435-00X) WITH CURRENT PRODUCTION (PART NO. 66311-0XX) SUPPORT BEAM ASSEMBLIES ATTACHED TO THE SAME (AXLE) CROSS TUBE. USE OF DIFFERENT SUPPORT BEAM ASSEMBLIES AND/OR AIR SPRINGS ON THE SAME (AXLE) CROSS TUBE CAN RESULT IN VEHICLE LEAN AND/OR VEHICLE HANDLING PROBLEMS. IT IS ALLOWABLE TO HAVE DIFFERENT U-BEAM ASSEMBLY TYPES ON DIFFERENT AXLES.

U-BEAM ASSEMBLY SERVICE KITS

Support beam assemblies are available for field service purposes in U-beam assembly kits, refer to Table 1 on page 3. Former PRIMAAX • FIREMAAX suspension support beam assemblies must be serviced with these kits.

Each service kit, see Figure 2, is intended for servicing the associated suspension parts on one axle, and includes two new support beam assemblies, one cross tube, two air spring assemblies, air spring hardware, QUIK-ALIGN® hardware and D-pin hardware.

No. 60961-XXX includes				
DESCRIPTION	Qty.			
Support Beam Assembly	2			
Cross Tube	1			
Air Spring Assembly	2			
Air Spring Fasteners				
QUIK-ALIGN Fasteners				
D-Pin Fasteners				

NOTE

The support beam forging number, see Figure 3, can be used to help identify the support beam assembly part numbers and the U-beam assemblies that contain them. Support beam assembly part numbers **are not** shown on the beam.

FIGURE 3



PRIMAAX 230/460/690

FIREMAAX 240/480

NOTE

The support beam forging numbers can be used to help identify the support beam assembly part numbers and the U-beam assemblies that contain them. Support beam assembly part numbers are not shown on the beam.

PRIMAAX 260/5200/780

DISCONTINUED Forging Number 59363-001 65082-000 DISCONTINUED Forging Number 65284-000

LEFT RIGHT REAR 60831-001 60831-002 FRONT 60831-003 60831-004 REAR 66435-001 66435-002 FRONT 66435-003 66435-004

DISCONTINUED
Forging Number
59363-001
65082-000

DISCONTINUED
Forging Number
65284-000

- (1 INLIMAAX 270/040							
	DISCONTINUED SUPPORT BEAM ASSEMBLIES							
		LEFT	RIGHT					
	REAR	60831-005	60831-006					
	FRONT	60831-007	60831-008					
	REAR	66435-005	66435-007					
	FRONT	66435-007	66435-007					
\								

2 SEU-0229



TABLE 1

Vehicle Manufacturer	Drive Axle	*Frame Width	Discontinued Support Beam Assembly Part Number 60831-00X • 66435-00X		Cross Tube Part Number	New U-beam Assembly Service Kit Number
			Makes Marak	Forward	00.5"	-003
Volvo • Mack	Rear	33.5"	-001	-002	-238	
Kenworth • Western	Forward	0.4.01	-003	-004	-001	-235
Star • All Fire/Rescue (Except Spartan)	Rear	34.0"	-001	-002		-236
IPI • Advance •	Forward	34.0" Tall	-003	-004		-247
Oshkosh	Rear	Fab Hanger	-001	-002	-001	-248
Freightliner • Sterling •	Forward		-003	-004	-003	-241
Autocar	Rear	34.3"	-001	-002		-242
5	Forward	34.5"	-003	-004	-002	-239
Freightliner • Sterling	Rear		-001	-002		-240
	Forward	34.3"	-003	-004	-003	-261
	Rear		-001	-002		-262
	Forward	34.5"	-003	-004	-002	-263
International	Rear		-001	-002		-264
	Forward		-003	-004	-009	-243
	Rear	34.8"	-001	-002		-244
	P	RIMAAX 260/52	0/780 • FIRI	EMAAX 270 5	40	
Kenworth • Western Star • All Fire/Rescue	Forward	34.0"	-007	-008	-001	-253
(Except Spartan)	Rear		-005	-006		-254
	Forward		-007	-008	000	-257
Freightliner	Rear	34.3"	-005	-006	-003	-258
	Forward	34.5"	-007	-008	000	-255
	Rear		-005	-006	-002	-256

Refer any questions regarding this publication to Hendrickson Tech Services at 630.910.2800 or email: techservices@hendrickson-intl.com. Visit our website for more information on Hendrickson products, www.hendrickson-intl.com.

SEU-0229 3

www.hendrickson-intl.com -



Truck Suspension Systems 800 South Frontage Road Woodridge, IL 60517-4904 USA 630.910.2800 Fax 630.910.2899